
## Hex & Hex Washer Heads

## Head Dimensions

## **Self- Tapping Screws**

FASTENERS &

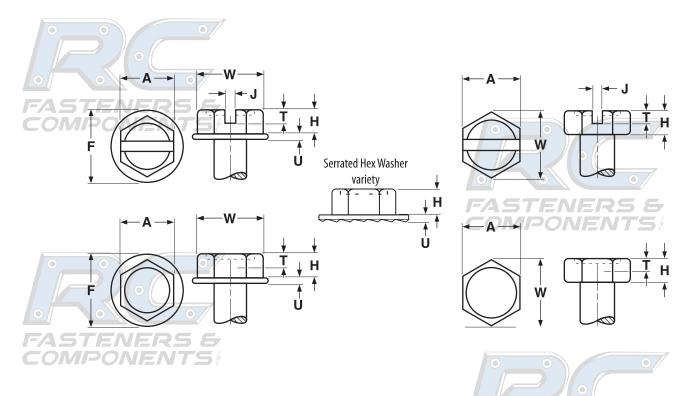

Hex & Hex Washer Heads for Self-Tapping & Self-Drilling Screws ASME B18.6.3- 2010*													
Nominal Size	A Width Across Flats		w	H Height of Head		F Diameter of Washer		UFASTENER				25 5	
			Width Across Corners					Thickness of Washer		Width of Slot		Depth of Slot	
	Max	Min	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min
4	.188	.181	.202	.060	.049	.243	.225	.019	.011	.039	.031	.036	.025
6	.250	.244	.272	.093	.080	.328	.302	.025	.015	.048	.039	.046	.033
7	.250	.244	.272	.093	.080	.328	.302	.029	.017	.048	.039	.054	.040
6801	.250	.244	.272	ž .110	.096	.348	.322	.031	.019	.054	.045	.066	.052
10	.312	.305	.340	.120	.105	.414	.384	.031	.019	.060	.050	.072	.057
12	.312	.305	.340	.155	.139	.432	.398	.039	.022	.067	.056	.093	.077
14	.375	.367	.409	.190	.172	.520	.480	.050	.030	.075	.064	.101	.083
1/4	.375	.367	.409	.190	.172	.520	.480	.050	.030	.075	.064	.101	.083
1/4**	.438	.428	.481	.230	.208	.590	.551	.063	.037	.084	.064	.122	.083
5/16**	.438	.428	.481	.230	.208	.590	.551	.063	.037	.084	.064	.122	.083
5/16	.500	.489	.545	.230	.208	.676	.624	.055	.035	.084	.072	.122	.100
3/8	.562	.551	.614	.295	.270	.780	.720	.063	.037	.094	.081	.156	.131
1/2*	.750	.735	.820	.400	.367	1.040	.960	.085	.050	.106	.091	.190	.165

\* Slot dimentions for 1/2-inch diameter hex washer head tapping screws are independient of ASME B18.6.3

\*\* Special dimensions for heads made to 7/16" across the flats

